

Service Service Service

Reference Number:


TV-05/0150

1. INTRODUCTION


On both Ambilight panels 3104 328 43702 & 39552, a wrong elco is stuffed on item number 2001:

- Wrong part: Lelon type, dimensions 10x16 (DxH)
- Correct part: Rubycon type, dimensions 10x12.5 (DxH), order code 2020 012 00018

2. SITUATION ON THE PWB

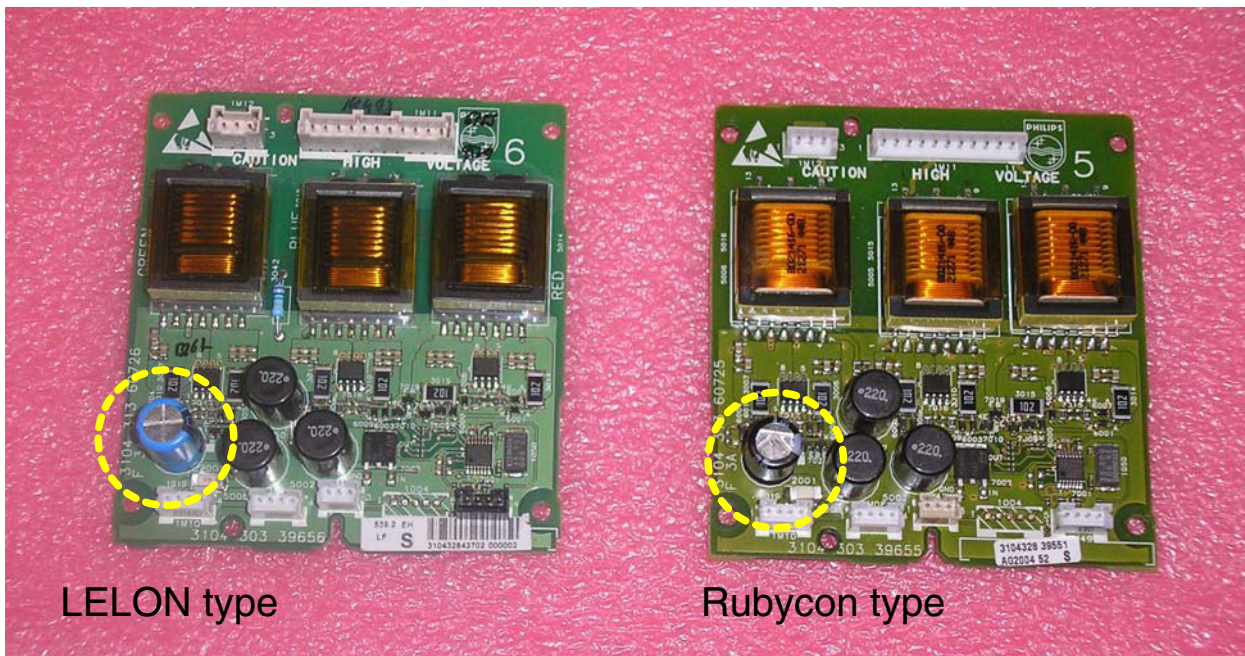

3. MAIN PROBLEM WITH THE LELON TYPE

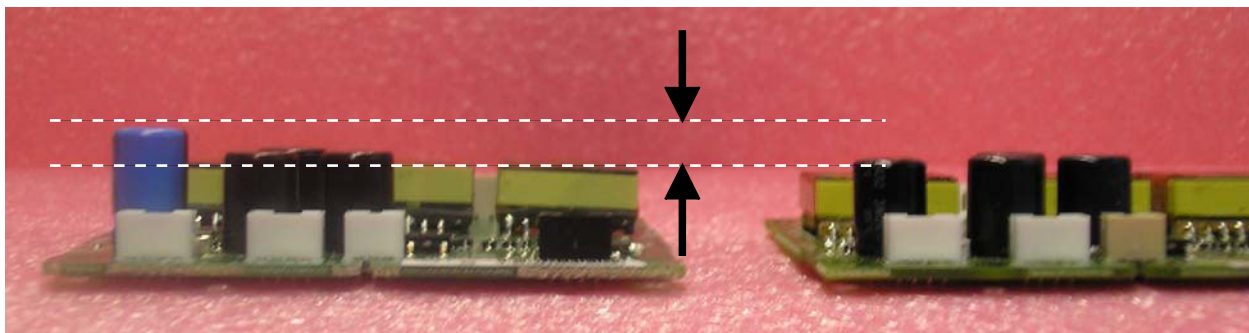

Different in height is not acceptable! This difference causes high safety problem.